

Abandon Ship Life Preserver Tip 010

Attaching Whistle to Mustang Survival Abandon Ship Life Preserver

1. Ensure work surface is clean and free from debris.
2. Obtain fibrous cord, MIL-C-5040B, Type I (SPMIG 03998); cut cord so the length of the cord from whistle's attachment point to the accessory pouch sewn tab will be between 46 to 50 inches, when attached. (Figure 1)

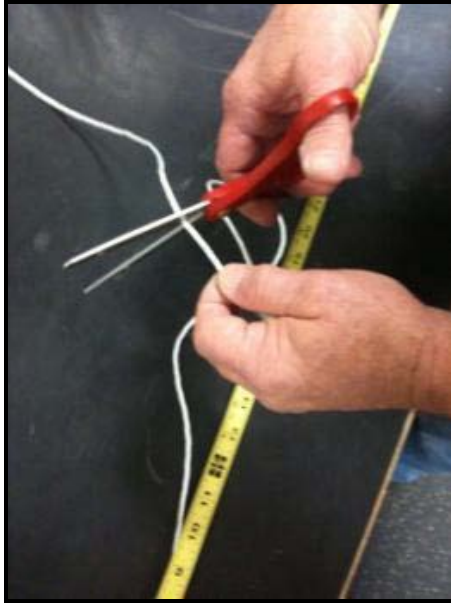


Figure1

3. Visually inspect whistle for damage and cracks. (Figure 2)



Figure 2

4. Tie whistle to one end of the cord with a bowline knot. (Figure 3)



Figure 3

5. Turn pouch inside out and secure the other end of the cord to the sewn tab inside the pouch with a bowline knot. Turn pouch right side out. (Figures 4 and 5)



Figure 4



Figure 5

6. Verify cord length from whistle's attachment point to the accessory pouch sewn tab is 46 to 50 inches. (Figures 6 and 7)

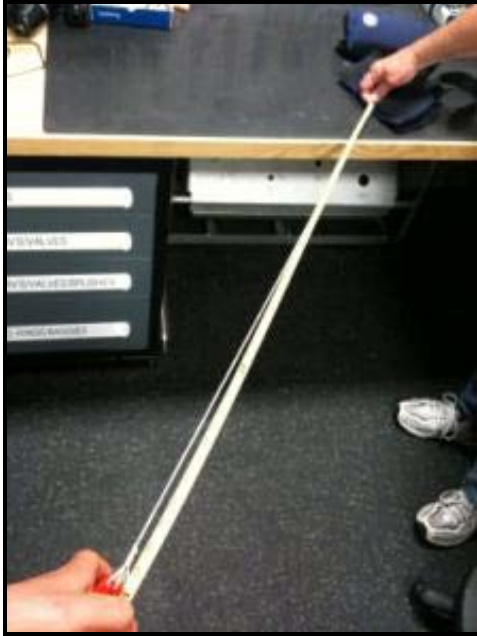


Figure 6

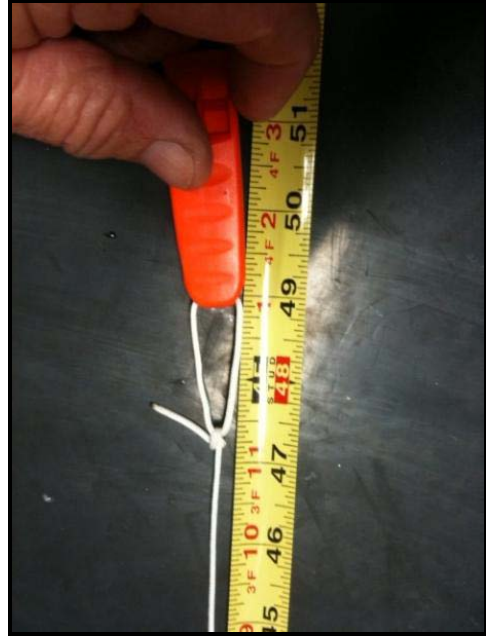


Figure 7

7. Wrap cord around whistle and Stow whistle and DML in pouch. (Figures 8 and 9)



Figure 8



Figure 9