

Abandon Ship Life Preserver Tip 009

Attaching Distress Marker Light (DML) to Mustang Survival Abandon Ship Life Preserver

1. Ensure work surface is clean and free from debris.
2. Obtain fibrous cord, MIL-C-5040B, Type I (SPMIG 03998); cut cord so the cord length from DML's attachment point to the accessory pouch sewn tab will be between 46 and 50 inches when attached. (Figure 1)



Figure 1

3. Attach cord to DML using a bowline knot. (Figure 2)



Figure 2

4. Turn pouch inside out and secure the other end of the cord to the sewn tab inside the pouch with a bowline knot. Turn pouch right side out. (Figures 3 and 4)



Figure 3



Figure 4

5. Verify the cord length from the DML's attachment point to the accessory pouch sewn tab is 46 to 50 inches. (Figures 5 and 6)

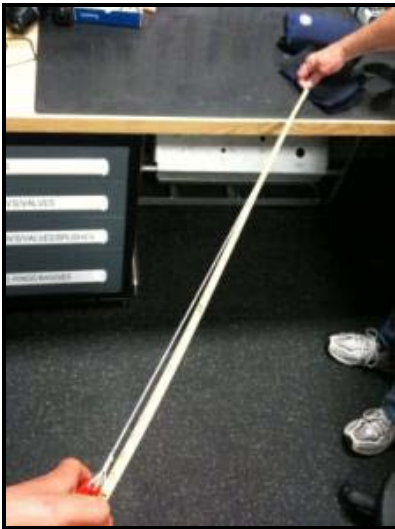


Figure 5



Figure 6

6. Wrap cord around DML and Stow DML in pouch. (Figures 7 and 8)



Figure 7



Figure 8